


# Swivel Adapter

- Temperature ratings: 15,000 psi @ 200° F and 3,000 psi @ 1,000° F
- Used with gauges and gauge valves to adjust the line of sight
- Rotates 360° to allow the connected instrument to be positioned in the desired direction
- The pressure connection is achieved with a tapered cone style compression fitting simply by tightening the swivel hex nut
- All 316 Stainless steel construction
- Standard with 1/2" NPT male process – 1/2" NPT female instrument connections
- Also available with 1/4" NPT connections

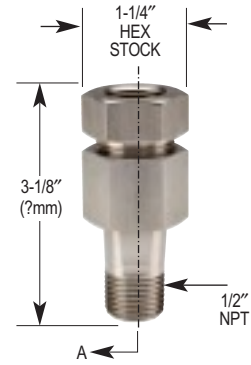

# Magnetic Spring Contact Switch (MSCS)

- An excellent choice when an accurate pressure switch is required in addition to a reliable pressure gauge
- Fully adjustable by the user
- These switches are actuated by the pressure gauge pointer to provide accurate field adjustment
- A removable adjustment key makes them tamper-proof
- They operate with an extremely broad power supply, AC or DC up to 250V max. (30W 50 VA), allowing them to be used virtually anywhere in the world in addition to very remote applications with only DC battery pack power available
- Standard units consist of (2) two magnetic spring switches; either one or both switches may be used:
  - Switch (1) one is normally closed
  - Switch (2) two is normally open with operation referenced on rising (or increasing) pressure
- Magnetic Spring Contact Switches are available as a factory installed option on models 40-105, 40-115, 40-400 and 40-410
- The lowest full scale pressure range this switch may be used on is 0 psi to 60 psi because of the increased load on the pointer and bourdon tube
- A matching 4-pin connector with 5 feet of 4-wire and color coded shielded cable is standard




Magnetic Spring Contact Switch

SPECIFICATIONS	
Type of Power	A.C. or D.C. 24 to 250V max
Maximum Amps	1.0 A
Maximum Switching Capacity	30W/50 VA
Gauge Accuracy	Add an additional ±2%
Minimum Magnet Holding Force	1g
Contact Pin Material	Silver Tungsten
Ambient Temperature Limitation	0°F to 140°F (-18°C to 61°C)
Minimum Full Scale Pressure Range	0-60 psi


### APPLICATIONS

- Air compressors
- Gas compressors
- Hydraulic and pneumatic circuitry
- Die-cast machinery
- Plastic injection molding machinery
- Anywhere accurate off/on switching capabilities based on pressure are required

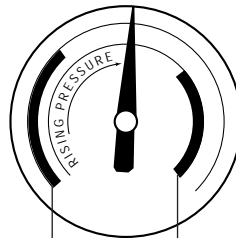

**CONTACT NO. 1**  
Normally Closed,  
Opens on Rising  
Pressure

**CONTACT NO. 2**  
Normally Open,  
Closes on Rising  
Pressure

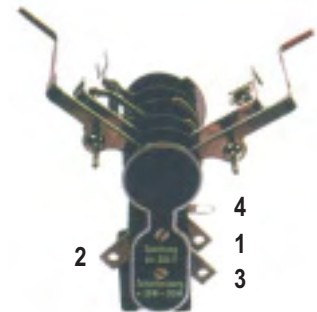

### WIRING AND TERMINAL LOCATION

1. Contact Switch No. 1; Red or Black
2. Contact Switch No. 2; Blue
3. Power; Green or Brown
4. Ground; Yellow/Green Stripe